## GEORGIA DEPARTMENT OF TRANSPORTATION

**Bridge Inspection Report** 

District:3Inspection Date: 7/2/2013Inspection Area: 08Bridge Inspector:Keith PinckardOver: LILLY BRANCHBridge Status: 06

**Location ID:** 093-00054X-000.60E **County:** Dooly

Structure ID: 093-5006-0 Road Name: WEEKS ROAD

EVALUATION & DEFICIENCIES

SubStructure: Year Painted: 0000

6-9 timber piles and concrete caps 21" D x 24" W x 38' L

Bent 4 = H-3 Calculated 2003 by Central Office (Load Factor). Revised 2009 Revised 2011

Timber piles are fair except for the following:

Bent 2, pile 1 has rot in outer shell (see photo).

Bent 4, piles 3 and 5.

Bent 5, pile 2.

Bent 7 pile 2 and pile 6 has 6" D x 10" W x 14" H decayed area. (see photo).

SuperStructure: Year Painted: 1955

7 - W12x31 steel beams with 7 span @ 16' =112'

Span 3 = H-16- Calculated 2003 by Central Office (Load Factor).

Moderate corrosion and section loss of 1/16" in bearing areas of bent 5 beam 1 and also on anchor bolts.

Anchor nuts are corroded with majority of nuts having corroded away.

Steel elements need cleaning and painting.

## Deck:

5" concrete deck

Deck rating deemed adequate for Superstructure capacity July, 2003

Moderate shrinkage cracking and moderate scaling.

Joints open and leaking. 2" gap between slabs.

Parapet has several spalls thru-out.

Hole in the deck at span 2 where piles have been driven for straddle bent. The hole has exposed rebar and small pieces of concrete in the holes, needs repairing. 2009 - Talked with Tom Watson about hole in deck and he advised that he would repair it. Repaired with tar & gravel. 2013.

## General:

Built 1955. 112' x 24'. 45 degree skew.

Ladder not needed.

Calculations for this structure were determined by the Central Office. July, 2003. Revised November 2009. Revised October 2011 SGM

Recommended repairs:

Remove drift on upstream side at bents.

Joints need sealing.

Steel elements need cleaning and painting.

Replace pile 1 at bent 2, piles 3 and 5 at bent 4, pile 2 at bent 5 and piles 2 and 6 at bent 7.

Repair wash @ Abutment 8 Right.

**Report Date:** 10/16/2013 **B.I. - 1** 

## GEORGIA DEPARTMENT OF TRANSPORTATION

**Bridge Inspection Report** 

District:3Inspection Date: 7/2/2013Inspection Area: 08Bridge Inspector:Keith PinckardOver: LILLY BRANCHBridge Status: 06

**Location ID:** 093-00054X-000.60E **County:** Dooly

Structure ID: 093-5006-0 Road Name: WEEKS ROAD EVALUATION & DEFICIENCIES

**Condition Rating** 

Component	Material	Rating
Substructure	Timber/Concrete	3
Superstructure	Steel	5
Deck	Concrete	5

Temp Shored: No								
Truck Type	Gross/H-Mod	HSMod	Tand	3-S-2	Log	Piggy		
Calculated Posting	04	00	00	00	00	00		
Posting Required	Yes	No	No	No	No	No		
Existing Posting	04	00	00	00	00	00		

\*\*\*School Bus Route.\*\*\*\*

**Structure Requires Posting** 

**Report Date:** 10/16/2013 B.I. - 2