


# GEORGIA DEPARTMENT OF TRANSPORTATION

## SubStructure Report

District: 4  
 Bridge Inspector: Benny Lomineck  
 Location ID: 275-00011X-000.62E  
 Structure ID: 275-5003-0

Inspection Date: 1/4/2011  
 Over: MCKEEVER SLOUGH CRK  
 County: Thomas  
 Road Name: REICHERTVILLE RD

Inspection Area: 11  
 Skew: 00

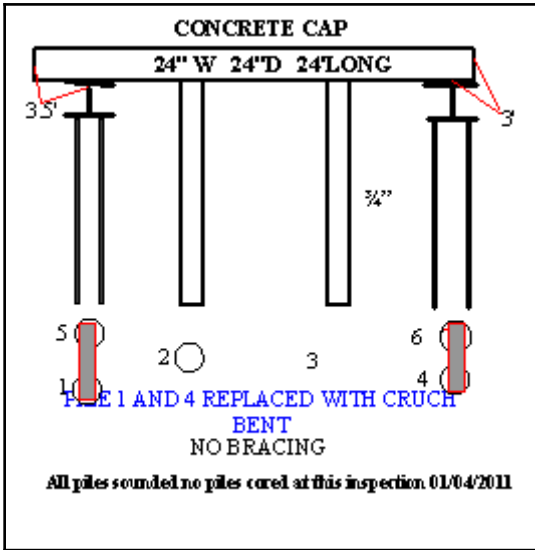

Bent #:	2	Picture Type:	4		
Deck:					
Material:	Concrete	Width:	24.70	Depth:	10.00
		Plank:	0.00		
Cap:					
Material:	Cast-In-Place				
Beam:					
	<u>FWD</u>	<u>REAR</u>	<u>FWD</u>	<u>REAR</u>	
Material:	Concrete	Concrete	Width:	24.70	24.70
			Depth:	10.00	10.00
Steel Beam:					
	<u>FWD</u>	<u>REAR</u>	<u>Yr-Fab</u>		
Weight (#/ft):	0	0			
SX (in3):	0	0			

**Piles:**

# of Piles: 6      Super Structure Height (ft.): 2.50  
 Overburden  
 Soil (in.): 0.00      Asphalt (in.): 0.00

<u>Pile</u>	<u>Cir</u>	<u>Core Loc</u>	<u>Depth</u>	<u>Pent</u>	<u>Unbrace</u>	<u>Condition</u>	<u>Length</u>	<u>Spacing</u>
1	31.00	1'10" BELOW CAP	4.50	0.50	3.30	FAIR	3.30	6.00
2	36.00	2'8" BELOW CAP	4.20	0.25	4.40	FAIR	4.40	6.70
3	39.00	3'6" BELOW CAP	4.50	0.75	4.40	FAIR/SOFT	4.40	6.50
4	31.00		0.00	0.00	3.60	FAIR	3.60	0.00
5	31.00	1'7" BELOW CAP	4.00	0.25	3.30	FAIR	3.30	4.00
6	31.00		0.00	0.00	3.60	FAIR	3.60	4.00

**Comments:**

CONCRETE CAP  
 CRUTCH BENTS REPLACING PILES 1 AND 4, WITH , 2 PILE CRUTCH AND 6' STEEL H PILE AS CAP  
 All piles sounded no piles cored at this inspection 01/04/2011

