

# Georgia Department of Transportation Quality Assurance

## Office of Design Policy and Support

### InRoads/CAiCE Survey Database(s) for Consultant QA Check

DATE: MAY 14, 2014

QC REVIEWER: OFFICE OF DESIGN POLICY AND SUPPORT


PROJECT: STP00-0002-07(020)

PI NUMBER: 122200-

REVIEWED BY: CB - ODPS

#### FILE CHECK LIST AND REMARKS/COMMENTS

NAME OF FILE	REMARKS/COMMENTS
122200_SDE.DTM	<p><b><u>DTM</u></b></p> <ul style="list-style-type: none"><li><b><u>Please Note:</u></b> When reviewing the Resolve Crossing Segments and selecting the Interactive option &lt;0.020, there were approximately 385 mismatched elevations or overlaps with a 0.00 elevation difference. In some cases, this indicates an exact duplicate of a feature and points. Please verify if duplicates exist and if so whether or not they need to be resolved/deleted. For example, features TOPO_E_TPBL-333 and TOPO_E_TPBL-288 are reported as crossing segments with an elevation delta of 0.000. When displaying both of these features you can use the move command in MicroStation and determine that both features are exact duplicates of one another. See screen capture #1.</li></ul> <p><b><u>ALG</u></b></p> <ul style="list-style-type: none"><li>Alignments SV100, SV101 are missing point names at the beginning and/or ending of the alignments. These will need to have point names assigned and converted cogo points.</li></ul>
122200_SDE.ALG	

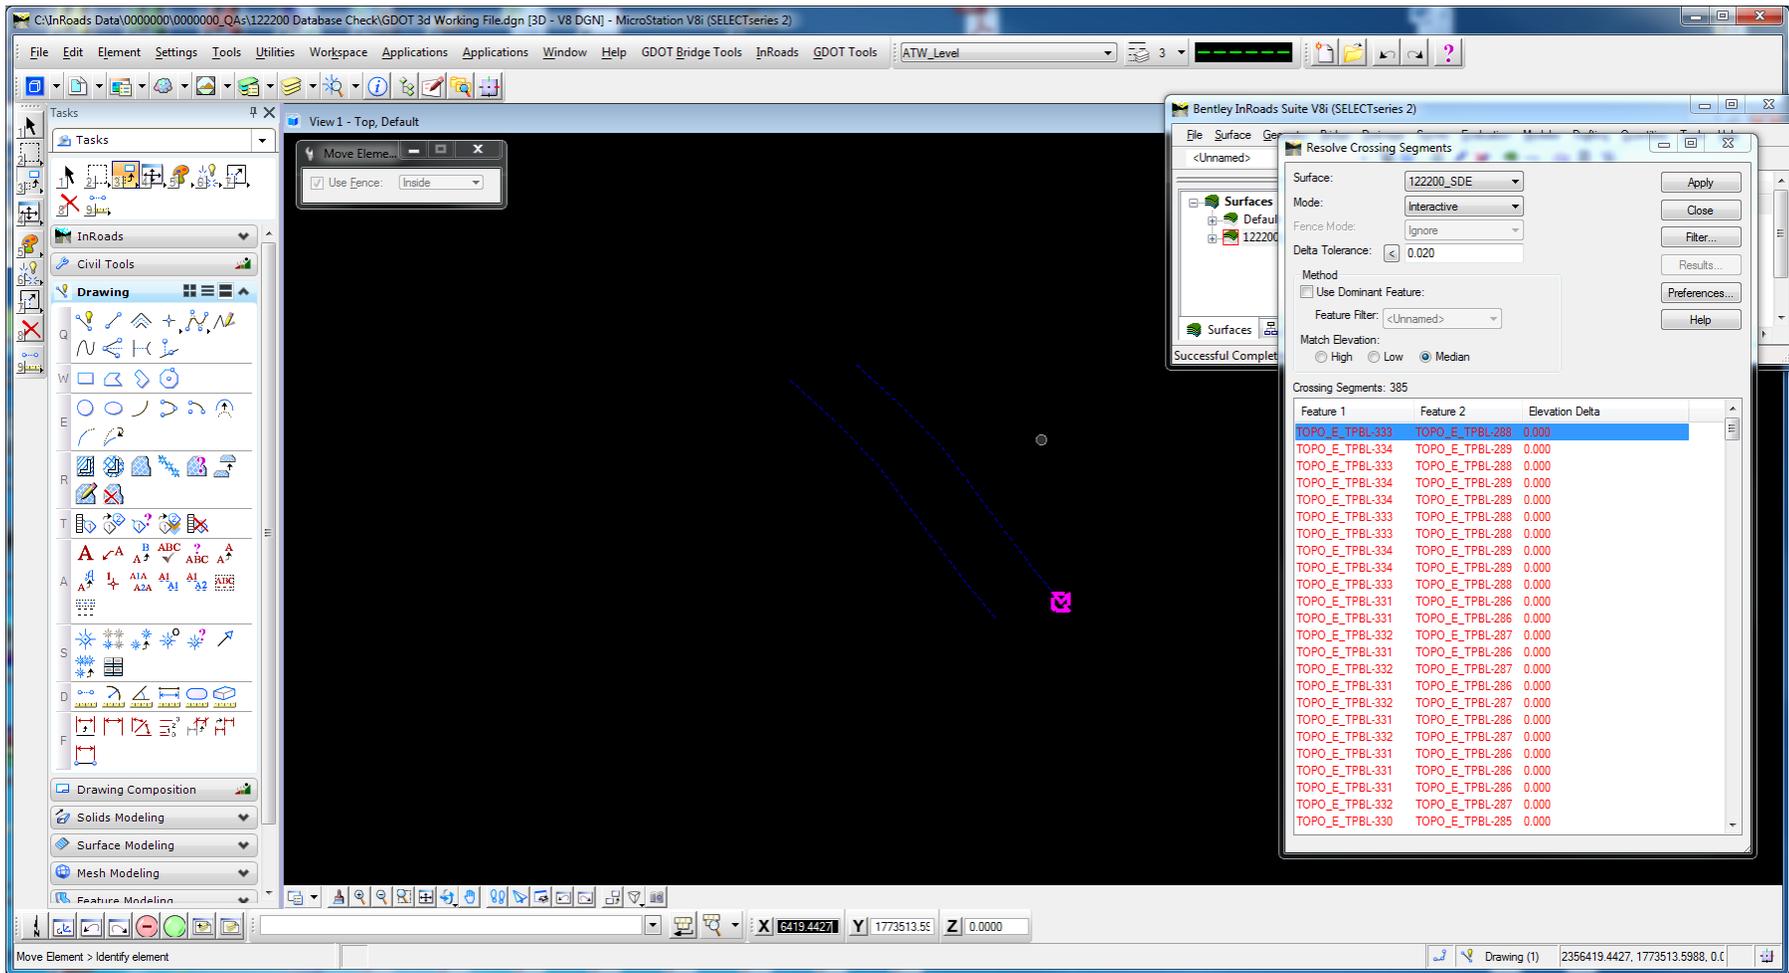

SCREEN CAPTURE #1