

GEORGIA DEPARTMENT OF TRANSPORTATION

Waterway Report

District: 3
Bridge Inspector: Keith Pinckard
Location ID: 093-00054X-000.60E
Structure ID: 093-5006-0

Inspection Date: 7/2/2013
Over: LILLY BRANCH
County: Dooly
Road Name: WEEKS ROAD

Inspection Area: 08

Skew: 45

Span #:	1	2	3	4	5	6	7
Length:	16.0	16.0	16.0	16.0	16.0	16.0	16.0

Upstream -

Upstream +		1	2	3	4	5	6	7	8
07/01/1997	lem		9.00	8.00	9.00	8.00	7.00	7.00	2.00
08/31/1999	JLA/JD		7.30	9.50	8.10	8.30	7.50	6.50	2.00
10/16/2001	jla/jd		7.20	9.00	8.00	7.80	7.20	6.50	2.50
08/11/2003	JLA/JD		7.00	9.30	8.20	8.00	7.30	6.20	2.00
08/01/2005	JLA/JD		7.60	10.20	8.80	8.30	7.70	6.60	1.70
08/22/2007	JLA/JD		7.70	9.50	7.50	6.70	7.40	6.40	2.00
08/26/2009	jla/car		7.80	10.00	7.40	7.00	7.20	6.40	2.00
08/16/2011	VTT/BRL		8.30	9.70	7.60	7.00	7.60	6.40	2.80
07/02/2013	JKP/KJT		8.50	10.20	8.50	7.70	7.70	6.70	2.00

Downstream -

Downstream +		1	2	3	4	5	6	7	8
07/01/1997	lem		8.00	8.00	9.00	9.00	7.00	7.00	2.00
08/31/1999	JLA/JD		6.00	7.80	9.50	10.00	8.00	7.50	1.50
10/16/2001	jla/jd		6.00	7.50	9.20	9.80	7.60	6.80	2.00
08/11/2003	JLA/JD		5.70	8.00	9.00	10.00	7.80	7.10	2.30

GEORGIA DEPARTMENT OF TRANSPORTATION

Waterway Report

District: 3
Bridge Inspector: Keith Pinckard
Location ID: 093-00054X-000.60E
Structure ID: 093-5006-0

Inspection Date: 7/2/2013
Over: LILLY BRANCH
County: Dooly
Road Name: WEEKS ROAD

Inspection Area: 08

Skew: 45

		1	2	3	4	5	6	7	8
08/01/2005	JLA/JD		5.80	8.00	9.50	10.00	7.80	7.30	1.50
08/22/2007	JLA/JD		5.80	8.00	9.30	9.80	7.80	7.00	1.70
08/26/2009	jla/car		6.00	8.00	8.80	9.40	7.80	7.20	2.40
08/16/2011	VTT/BRL		6.00	8.00	9.40	10.00	7.80	7.20	3.50
07/02/2013	JKP/KJT		6.20	8.20	9.60	10.30	7.80	7.40	2.50


GEORGIA DEPARTMENT OF TRANSPORTATION

Waterway Report


District: 3
 Bridge Inspector: Keith Pinckard
 Location ID: 093-00054X-000.60E
 Structure ID: 093-5006-0

Inspection Date: 7/2/2013
 Over: LILLY BRANCH
 County: Dooly
 Road Name: WEEKS ROAD

Inspection Area: 08
 Skew: 45

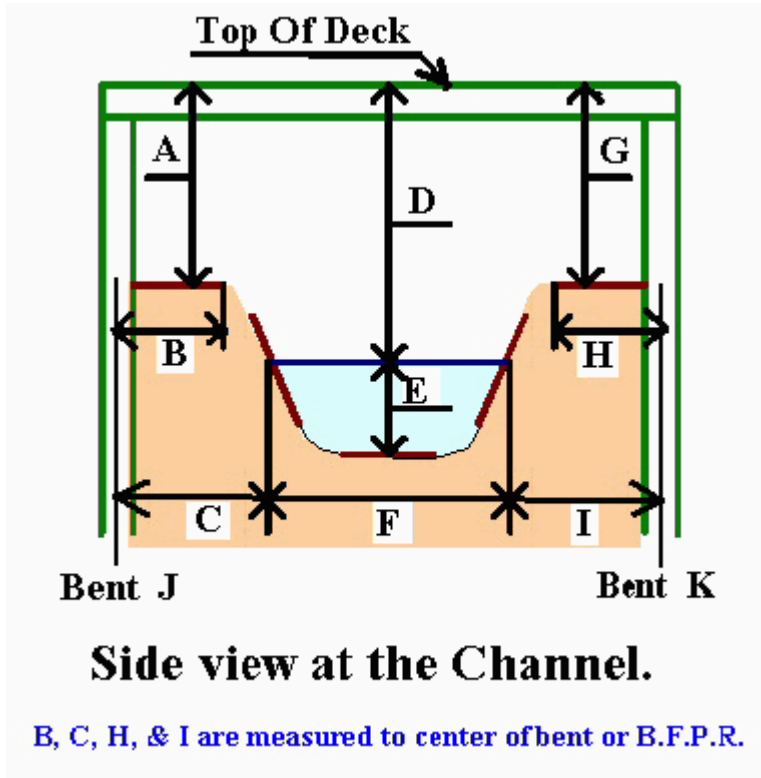

- A: 5
- B: 12
- C: 22
- D: 8.1
- E: 2.8
- F: 60
- G: 3
- H: 3
- I: 30
- J: 1
- K: 8

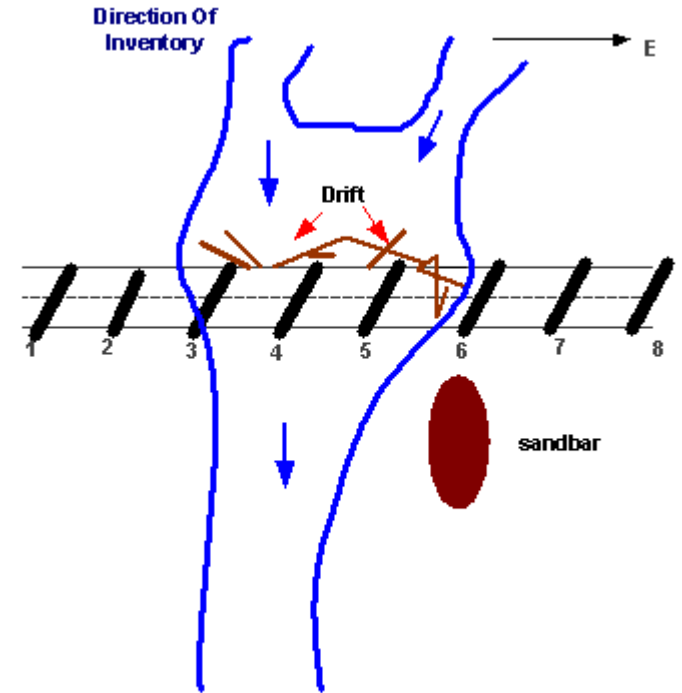

Location of Bridge Height 3' rear Bent 3 Upstream

Scour Condition: 8 Waterway Adequacy: 7 Channel Protection: 5

Comments:

None.

45 = SubStructure
 40 = Channel Skew
 5 = Stream Angle